

# WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No. <b>121</b>	Street <b>Mary Paige Lane</b>	City <b>Santa Rosa</b>	Zip <b>95404</b>	Date of Inspection <b>03/27/18</b>	Page <b>1 of 10</b>
----------------------------	----------------------------------	---------------------------	---------------------	---------------------------------------	------------------------

	<b>SCHORK INSPECTION SERVICES INC.</b> 2209 SPRINGWOOD COURT SANTA ROSA, CA 95403-8101 Phone: 707-571-8177 Fax: 707-527-9444 killabug4u@aol.com Registration # PR4556	
<b>Report # 121marypai</b>		

Ordered by: <b>Atrisen Sotheby's International</b> <b>Mary Haufler</b> <b>403 Chinn</b> <b>Santa Rosa, CA 95404</b>	Property Owner and/or Party of Interest: <b>David Phillips</b> <b>121 Mary Paige Lane, Santa Rosa, CA</b> <b>95404</b>	Report sent to: <b>David Phillips</b> <b>121 Mary Paige Lane, Santa Rosa, CA</b> <b>95404</b>
---	---	--

COMPLETE REPORT  LIMITED REPORT  SUPPLEMENTAL REPORT  REINSPECTION REPORT


General Description: <b>Single story, frame, rustic siding, decking garage attached.</b>	Inspection Tag Posted: <b>Attic</b>
	Other Tags Posted: <b>None noted</b>


An inspection has been made of the structure(s) shown on the diagram in accordance with the Structural Pest Control Act. Detached porches, detached steps, detached decks and any other structures not on the diagram were not inspected. Diagram is not to scale. Locations are only approximate.

Subterranean Termites  Drywood Termites  Fungus / Dryrot  Other Findings  Further Inspection

If any of the above boxes are checked, it indicates that there were visible problems in accessible areas. Read the report for details on checked items.

KEY: 1 - Exterior    2 - Garage    3 - Interior    4 - Substructure Area    5 - Attic Spaces

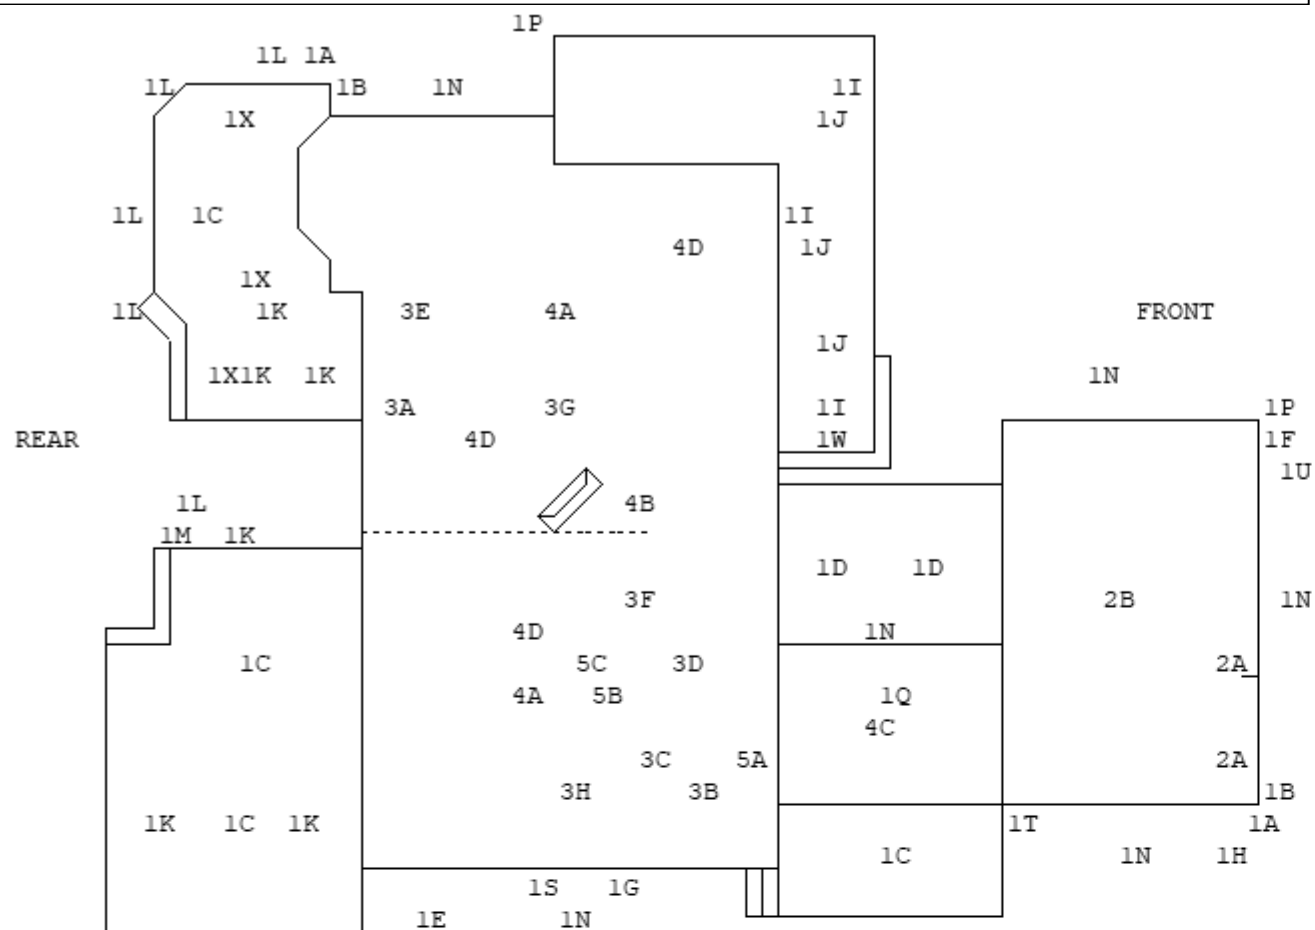

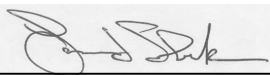Inspected by: **LAWRENCE J. SCHORK**    State License No. **OPR6686**    Signature 

You are entitled to obtain copies of all reports and completion notices on this property reported to the Structural Pest Control Board during the preceding two years. To obtain copies contact: Structural Pest Control Board, 2005 Evergreen Street, Suite 1500, Sacramento, California, 95815-3831.  
 NOTE: Questions or problems concerning the above report should be directed to the manager of the company. Unresolved questions or problems with services performed may be directed to the Structural Pest Control Board at (916) 561-8708, (800) 737-8188 or [www.pestboard.ca.gov](http://www.pestboard.ca.gov).

## WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No. <b>121</b>	Street <b>Mary Paige Lane</b>	City <b>Santa Rosa</b>	Zip <b>95404</b>	Date of Inspection <b>03/27/18</b>	Report # <b>121marypai</b>	Page <b>2 of 10</b>
----------------------------	----------------------------------	---------------------------	---------------------	---------------------------------------	-------------------------------	------------------------

PLEASE READ THE FOLLOWING CAREFULLY.

\* GENERAL INFORMATION THAT MAY OR MAY NOT APPLY TO THIS STRUCTURE \*

Certain areas are recognized by the industry as inaccessible and/or for, other reasons not inspected. These include but are not limited to, Inaccessible and/or insulated attics or portions thereof, attics with less than eighteen inches of clear crawl space, interior of hollow walls; spaces between a floor or porch deck and the ceiling below, areas where there is no access without defacing or tearing out of lumber, masonry or finished work; areas where encumbrances and storage conditions or locks make inspection impractical, and areas of timbers around eaves, gables, in attics, or areas above 10 feet in height, that would require the use of an extension ladder, and a fall restraint system, (Effective Jan 2017, installed by others), for ladder heights above 4 feet for access and inspection. These areas were not inspected unless described in this report. We recommend further inspection if there is any question about the above listed areas.

An inspection report expresses the absence or presence of wood destroying pests and organisms in areas physically and visibly accessible for inspection, and is predominately a noninvasive visual inspection only. There is no requirement in the law making probing or destructive testing part of this type of inspection. This company is not responsible for conditions found by others using destructive probing, which were not visible, prior to the invasive probing. This company will inspect and document these conditions on a supplemental inspection report when advised of such conditions. **THIS IS NOT A GENERAL PEST CONTROL INSPECTION REPORT.** (I.e. rodents, vermin, snakes, spiders, or other insect conditions which we are not licensed to ID or exterminate.)

A standard inspection report covers conditions relative to wood destroying organisms, termites fungus (wet rot), boring beetles, and other wood destroying pests found in exposed accessible structural timbers in the basement and or below the first subfloor level, including those areas on the interior and exterior of the structure which are visibly and physically accessible for inspection, and is intended to be reasonably detailed and accurate.

This report is limited to what was found in the exposed and physically accessible areas and what we deemed necessary to document at the time of inspection. We assume no responsibility for concealed or inaccessible damage, infestation or infection that was not observed by the inspector without excavating soil, dismantling of heating ducts, removal of insulation, or opening timbers, walls, floor coverings, or interior of closed decking and/or porch hand rails, or floors, ceilings, moving of furnishings, installed carpet, appliances, or stoves is not with the scope of an inspection. We shall not be liable for any damage resulting from probing, cutting, opening or removal, or otherwise of timbers, walls, floors, floor coverings, or other parts of the structure inspected.

In the course of inspection, if reason is found by the inspector to suspect hidden infestation, infection or damage in a concealed or inaccessible area, recommendations for further inspection will be made, and an additional inspection fee charged.

This company will reinspect repairs done by others within four months (4) from the date of the original inspection. A Charge if any can be no greater that the original inspection fee for each reinspection. A reinspection must be done within ten (10) working days of the request. The reinspection is a visual inspection of finished accessible surfaces, if inspection of concealed areas is desired, inspection of work in progress will be necessary. Any Guarantees must be received from the parties performing repairs, not the inspector or the inspection company. An exception to the fee rule above is when the inspector performs more than one inspection, of repairs in progress by others. Charges in these cases will vary depending on the length of time involved, and will be in addition to any charges for work performed by this company

The inspection of concealed or inaccessible areas including areas behind EIFS (exterior insulation finish systems), detached garages, walkways, retaining walls, fences, interior of closed decking and porch rails, other out buildings, or structures, and water testing of stall showers over finished ceilings, were not inspected unless requested. These areas can be inspected, at

## WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No. <b>121</b>	Street <b>Mary Paige Lane</b>	City <b>Santa Rosa</b>	Zip <b>95404</b>	Date of Inspection <b>03/27/18</b>	Report # <b>121marypai</b>	Page <b>3 of 10</b>
----------------------------	----------------------------------	---------------------------	---------------------	---------------------------------------	-------------------------------	------------------------

additional cost, upon written authorization.

When infestation and damaged is described in the report, the extent of the damage is not always evident to the inspector. Therefore, further inspection is recommended in any case where areas are inaccessible for inspection. If any damage is uncovered during repairs, previously hidden or inaccessible, a supplemental report can be generated to outline the findings and extended recommendation for the inaccessible damage, and will be contracted for separately before work continues in the area.

Recommendations will be made for correction and or control of actual infestation or infection, and damage found. Conditions found by the inspector that are likely to cause infestations or infections will be reported.

Any further inspection recommended must be authorized in writing by the property owner, or their agent, and/or the buyer, and/or agent and must be paid for at the time of inspection, unless otherwise arranged. Further inspection shall be reported on a supplemental report and any work contracted for separately from the original report. The further inspection fee will not exceed the original inspection fee.

Further inspection is recommended of flooded areas, contaminated areas, and any area covered with insulation, or inaccessible because of heating ducts and/or plumbing, and will be performed if requested in writing, after standing water is gone, and sufficient drying has taken place to allow for complete access, contaminated area cleaned up, insulation removed, heating ducts dismantled and/or plumbing moved, by others prior to inspection.

This report is subject to review ninety days from the date shown on the report. If the forgoing and the information given herein is in variance with the desires and instructions of any person concerned with this report or fails to conform to known data about the property, inform Schork Inspection Services Inc. immediately at 707-571-8177 and refrain from use of this report until a full understanding is reached.

Recommendations for corrective measures given in this report are subject to local city and/or county building codes and may require a building permit. Parties of interest should consult with the local city and/or county building officials regarding permit requirements for repair of specific items in this report. Any changes made by those agencies in the plans or specifications of repair, can result in issuance of a separate report with changes in writing, and added cost of repair. Parties contracting to have work performed are responsible for the added cost.

Location of conditions indicated on the diagram are approximate locations. Persons undertaking repairs are responsible for all necessary repairs, including those which may be extensions of repair into inaccessible areas. Inaccessible areas are subject to additional charge.

The bottom of the diagram is the front of the structure, and the top of the diagram is the rear of the structure, unless noted otherwise on the diagram. The diagram is not a scale drawing, only a representation of the structure outline.

Persons undertaking and performing structural repairs on the property need to have the knowledge, expertise, and licenses necessary to complete the work, and accept full liability for any work performed. The use of alternative repair methods other than described in this report, as well as the quality of repair are the sole responsibility of the person performing the work. No guarantees are expressed or implied on work performed by others.

If there are areas of the structure where repairs are evident, this company cannot and will not guarantee the quality of the materials used, the workmanship, or the extent of the repair into inaccessible areas where work has been performed by others. This is the responsibility of the person who performed the work. Further questions pertaining to the repairs or guarantees should be directed to the person or contractor who performed the work. Building code compliance is the

## WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No. 121	Street Mary Paige Lane	City Santa Rosa	Zip 95404	Date of Inspection 03/27/18	Report # 121marypai	Page 4 of 10
---------------------	---------------------------	--------------------	--------------	--------------------------------	------------------------	-----------------

responsibility of the parties who did the work, and the city and/or county building officials, not the wood destroying organisms inspector.

You should be aware of Business and Professions Code 7024, 7044, and 7048, which state that it is illegal for unlicensed people to do work on a property being sold for one year prior to the date of sale. People doing such work should be prepared to provide license numbers, insurance coverage, and guarantees to other parties of interest in the property. Buyers of the property are entitled to know who is doing, or did the work, that they are qualified, and the buyers will have recourse if there is a problem with the work at a later date.

Business and Professions Code Division 3.8552 Unlawful Representation, It is unlawful for any person to advertise or represent that any pest control work, or chemical application, in whole or in part has been done on a structure, unless the work has been performed by a person licensed under this chapter. THIS COMPANY CANNOT REINSPECT, CONFIRM, OR CERTIFY CHEMICAL TREATMENTS PERFORMED BY A NON-LICENSED PERSON. ALL CHEMICAL TREATMENTS MUST BE PERFORMED BY A LICENSED CHEMICAL APPLICATOR.

The charge for services that this company subcontracts to another registered company may include this company's charges for arranging and administering such services that are in addition to the direct cost associated with paying the contractor. You may accept Schork Inspection Services Inc. bid or you may choose to contract directly with another registered company, person, or entity, licensed to perform the work. If you choose to contract directly with another registered company, person or entity, Schork Inspection Services Inc. will not be responsible for any act or omission in the performance of the work you directly contracted for others to perform.

**NOTICE: REPORTS ON THIS STRUCTURE PREPARED BY VARIOUS REGISTERED COMPANIES SHOULD LIST THE SAME FINDINGS (IE TERMITE INFESTATION, TERMITE DAMAGE, FUNGUS DAMAGE ETC) HOWEVER RECOMMENDATIONS TO CORRECT THESE FINDINGS MAY VARY FROM COMPANY TO COMPANY. YOU HAVE THE RIGHT TO SEEK A SECOND OPINION FROM ANOTHER COMPANY.**

This inspection does not include an inspection of the exterior surface of the roof, gables, siding, eaves or attics above 8 feet in height that would require an extension ladder and a fall restraint system, installed by others for inspections above 4 feet (effective Jan 2017). If you want the water tightness of the roof determined, you should contact a roofing contractor who is licensed by the Contractors State License Board. This inspection does not include a plumbing, electrical, engineering analysis, asbestos or related hazards, or earth quake soundness of the structure inspection. This inspection does not include an inspection of areas behind EIFS (Exterior insulation finish systems. This inspection does not include an inspection for the absence or presence of health related molds or fungi. The presence of moisture conditions can be conducive to mold growth. Under California law we are not qualified, nor authorized or licensed to inspect for health related molds or fungi. Parties of interest should consult with individual specialist and/or industrial Hygienist regarding any of the above listed areas or conditions that may apply to this structure. This inspection does not include an inspection for lead based paint.

Under mechanics lien law any structural pest control operator who contracts to do work for you, any contractor, sub-contractor, laborer, supplier, or other person who helps to improve your property, but is not paid for his work or supplies, has the right to enforce a claim against your property. This means that after a court hearing, your property could be sold by a court officer and the proceeds of the sale used to satisfy the indebtedness. This can happen even if you have paid your contractor in full, and sub-contractors laborers, or suppliers remain unpaid.

To preserve their right to file a claim or lien against your property, certain claimants such as sub-contractors, or material suppliers are required to provide you with a document entitled Preliminary Notice. General contractors and laborers for wages do not have to provide this notice. A preliminary notice is not a lien against your property. Its purpose is to notify you of

## WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No. <b>121</b>	Street <b>Mary Paige Lane</b>	City <b>Santa Rosa</b>	Zip <b>95404</b>	Date of Inspection <b>03/27/18</b>	Report # <b>121marypai</b>	Page <b>5 of 10</b>
----------------------------	----------------------------------	---------------------------	---------------------	---------------------------------------	-------------------------------	------------------------

persons that may have the right to file a lien against your property if they are not paid.

All chemically treated areas and newly installed wood members completed by this company are warranted for one year from the date of completion. Exceptions are areas treated as secondary control of wood destroying pests. Resetting of toilets and sealing of vinyl seams or shower doors and re-grouting which is warranted for thirty days. Final coat painting and wall papering is excluded, and should be contracted for separately by the parties of interest.

**\*IF AND/OR WHEN A CERTIFICATION IS ISSUED THE FOLLOWING INFORMATION WILL APPLY\***

A certification applies to the visible and physically accessible area of the structure which were included in the inspection report. This certification specifically does not cover areas which were not inspected or were inaccessible at the time of inspection, and does not guarantee or imply in any way, that the structure will be free from future attack or damage, or from infestation or damage now existing in the inaccessible, or otherwise not inspected areas, which may become visibly accessible at a future date, or during remodeling or repair.

State law requires that you be given the following information (PESTICIDES ARE TOXIC CHEMICALS) Structural pest control operators are licensed and regulated by the Structural Pest Control Board, and apply pesticides which are approved for use in California, by the Department of Agriculture, and Environmental Protection Agency. Registration is granted when the state finds that based on existing scientific evidence there are no appreciable risks, if proper use conditions are followed or that the risks do not outweigh the benefits. The Degree of risk depends upon the degree of exposure, so exposure should be minimized.

If within 24 hours following application, you experience symptoms similar to common seasonal illness comparable to flu, contact your doctor or a poison control center at 800-876-4766, Chemtrec at 800-424-9300 and your pest control operator at 707-571-8177

This statement shall be modified to include any other symptoms or overexposure which is typical of influenza.

For further information contact any of the following: Schork Inspection Services Inc. 707-571-8177 Sonoma County Department of Agriculture 707-565-2371 Sonoma County Department of Environmental Health 707-565-4567 Marin County Department of Agriculture 415-473-6700 Marin County Environmental Health 415-499-3696 and or regulatory information the Structural Pest Control Board 916-561-8700 in Sacramento.

The following is a list of the possible Pesticides that may be used on your property, if Schork Inspection Services Inc. performs the structural pest control pesticide applications recommended in the report.

Premise Foam / Premise 75 / Premise Granules / Premise Gel. For Termite control.

Active ingredient: Imidacloprid .05% 1-[(6-chloro-3-pyridinyl)methyl]-N-nitro-2-imidazolidinimine

Termidor Liquid/ Termidor Foam 0.005% Termidor dry, For termite control. Active ingredient: Fipronil .05% 5-amino-1-(2,6-dichloro-4-(trifluoromethyl)phenyl)-4-(1,R,S)-Trifluoromethyl sulfinyl)-1-H-Pyrazole-3-carbonitrile

Timbor. For fungus and termite control. Active ingredient: Disodium Octaborate Tetrahydrate 10%

D-Force HPX15. For control of termites, beetles, and carpenter bee. Active Ingredient: Deltamethrin .06%

# WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No.	Street	City	Zip	Date of Inspection	Report #	Page
121	Mary Paige Lane	Santa Rosa	95404	03/27/18	121marypai	6 of 10

Altriset. For termite control. Active Ingredient: Chlorantraniliprole 18.4%

FastOut CS Foam. For control of termites, beetles, and carpenter bee. Active Ingredient: Cyfluthrin 0.1%

XT-2000 Orange Oil Plus. For control of Drywood termites. Active Ingredient: d-Limonene 95%

Alpine Foam. For termite and ant control. Active Ingredient: Dinotefuran,-N-methyl-N'-nitro-N-(tetrahydro-3-furanyl)methyl)guanidine .025%

A separated report has been requested. It is defined as a Section One, or Section Two conditions evident on the date of inspection.

SECTION ONE Contains items where there is evidence of active infestation or infection that has resulted in or from infestation.

SECTION TWO Contains items deemed likely to lead to infestation, but where no visible evidence of such was found.

FURTHER INSPECTION Contains recommendations to inspect areas which during the original inspection did not allow the inspector access to complete his/her inspection, and cannot be defined as Section One, but may be defined as Section Two.

## **EXTERIOR:**

1A. FINDING Fungus damage noted to outer roof fascia trim.

RECOMMENDATION Parties of interest should consult with a roofing specialist regarding repair of this area. Remove damaged wood members and replace with new materials.

(SECTION I ITEM)

1B. FINDING Fungus damage noted to exterior verge rafter area.

RECOMMENDATION Parties of interest should consult with a roofing contractor regarding repair of this area. Remove damaged wood members and replace with new materials.

(SECTION I ITEM)

1C. FINDING Evidence of carpenter bees noted on the exterior.

RECOMMENDATION Treat these areas with a registered pesticide for the control of carpenter bees.

(SECTION I ITEM)

1D. FINDING Fungus damage noted to exterior trellis area wood members.

RECOMMENDATION Remove damaged wood members and replace with new materials.

(SECTION I ITEM)

1E. FINDING Fungus damage noted to exterior trellis beam area wood members.

RECOMMENDATION Remove damaged wood members and replace with new materials. (SECTION I ITEM)

1F. FINDING Fungus damage noted to exterior siding. Some siding patterns are no longer in production. substitutions that do not match the existing siding patterns may have to be used.

RECOMMENDATION Remove damage wood members and replace with new materials using available siding patterns and configurations. (SECTION I ITEM)

## WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No.	Street	City	Zip	Date of Inspection	Report #	Page
121	Mary Paige Lane	Santa Rosa	95404	03/27/18	121marypai	7 of 10

1G. FINDING Fungus damage noted to exterior siding at vent opening. Some siding patterns are no longer in production. substitutions that do not match the existing siding patterns may have to be used.

RECOMMENDATION Remove damage wood members and replace with new materials using available siding patterns and configurations. (SECTION I ITEM)

1H. FINDING Fungus damage noted to exterior trim, and possibly wood members under the trim.

RECOMMENDATION Remove damaged wood members and replace with new materials. (SECTION I ITEM)

1I. FINDING Random areas of fungus damage noted to portions of the front decking, and framing.

RECOMMENDATION Remove damaged wood members and replace with new materials as necessary at a time and materials basis only, including any areas adjacent to the main structure, or attachments to the structure. Scrape off fungus growth and treat the wood members with a registered fungicide for control of fungus. Areas marked on the diagram are general in nature to the deck and not specific to any one member. Parties of interest undertaking repairs should inspect the deck to determine all areas of repair, replacement, and or reinforcing. Decking areas are in an exterior location where there is no control over annual moisture intrusion. Regular maintenance repair and replacement of structural members will be required to maintain the integrity of the decking system, and extend the decks utility value. (SECTION I ITEM)

1J. FINDING Some fungus infestation was noted to wood members on the underside of the deck.

RECOMMENDATION Wire brush/scrape off fungus growth and treat wood members with a fungicide for control of fungus. (SECTION I ITEM)

1K. FINDING Fungus damage noted to decking girders joists, blocking and framing of the older deck framing.

RECOMMENDATION Remove Trex decking, remove damaged wood members and replace with new materials. (FURTHER INSPECTION ITEM)

1L. FINDING Fungus damage noted to outer deck fascia trim.

RECOMMENDATION Parties of interest should consult with a roofing specialist regarding repair of this area. Remove damaged wood members and replace with new materials. (SECTION I ITEM)

1M. FINDING Some earth to wood contacts were noted around decking wood members.

RECOMMENDATION Home maintenance should include eliminating earth to wood contacts where possible. (SECTION II ITEM)

1N. FINDING Swollen wavy siding noted on the exterior of the structure.

RECOMMENDATION Parties of interest should consult with a siding specialist regarding this type of siding and related conditions with regard to maintenance, repair and/or replacement. (SECTION II ITEM)

1O. FINDING Open siding seams are conducive to infestation.

RECOMMENDATION Building maintenance should include sealing open siding seams. (SECTION II ITEM)

1P. FINDING Leaks were noted in the exterior gutter system.

RECOMMENDATION Parties of interest should consult with a specialist regarding this condition. (SECTION II ITEM)

1Q. FINDING Moss growth noted on the roofing system.

## WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No. <b>121</b>	Street <b>Mary Paige Lane</b>	City <b>Santa Rosa</b>	Zip <b>95404</b>	Date of Inspection <b>03/27/18</b>	Report # <b>121marypai</b>	Page <b>8 of 10</b>
----------------------------	----------------------------------	---------------------------	---------------------	---------------------------------------	-------------------------------	------------------------

RECOMMENDATION parties of interest should consult with a roofing specialist regarding the roof condition and removal of moss growth.

(SECTION II ITEM)

1R. FINDING Some newer retro-fit windows have been installed by others. No Guarantee is expressed or implied on work performed by others.

RECOMMENDATION Parties of interest should consult with the window installation company regarding any questions, concerns, and guarantees, about the window installation.

(FURTHER INSPECTION ITEM)

1S. FINDING Bird damage noted in the gable area.

RECOMMENDATION Parties of interest should consult with a bird specialist regarding this issue.

Remove damaged areas and replace with new materials as a part of building maintenance.

(FURTHER INSPECTION ITEM)

1T. FINDING Cracks were noted in the foundation of the structure. Wood destroying pests can enter the structure through these cracks.

RECOMMENDATION Parties of interest should consult with a foundation specialist regarding this condition. Periodic inspection is recommended.

(FURTHER INSPECTION ITEM)

1U. FINDING Meter box is painted shut and inaccessible for inspection.

RECOMMENDATION Perform further inspection of the inaccessible area after the areas have been made accessible for inspection. File a report with findings and recommendations.

1W. FINDING Earth to wood contact to decking girder, and form lumber in the subarea under the front deck.

RECOMMENDATION Remove form lumber, correct earth to wood contacts, repair girder as necessary and replace with new materials.

(SECTION I ITEM)

1X. FINDING The underside of the back deck was inaccessible for inspection because of jammed access panel. Fungus damage noted from small opening at side of the deck to joisting and framing.

RECOMMENDATION Perform further inspection of the inaccessible area after the areas have been made accessible for inspection. File a report with findings and recommendations. (FURTHER INSPECTION ITEM)

### **GARAGE:**

2A. FINDING Fungus damage noted to the base of the garage door jambs.

RECOMMENDATION Cut off base of jambs and fill voids with concrete.

(SECTION I ITEM)

2B. FINDING Storage of personal items in the garage restricts access for inspection of this area.

RECOMMENDATION If requested in writing perform further inspection of this area after all storage has been removed.

(FURTHER INSPECTION ITEM)

### **INTERIOR:**

3A. FINDING Stains were noted on the interior ceiling from possible roof leaks.



## WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No.	Street	City	Zip	Date of Inspection	Report #	Page
121	Mary Paige Lane	Santa Rosa	95404	03/27/18	121marypai	9 of 10

RECOMMENDATION Parties of interest should consult with a specialist regarding this condition.  
(FURTHER INSPECTION ITEM)

3B. FINDING The master bath stall shower was water tested and no leaks became apparent in the shower pan at the time of inspection.

3C. FINDING Tile floors in the interior of the structure restrict access for inspection. (FURTHER INSPECTION ITEM)

3D. FINDING Cracked floor tiles noted in the hall bath and hallway area.  
RECOMMENDATION Parties of interest should contact a tile specialist regarding this issue. (FURTHER INSPECTION ITEM)

3E. FINDING Stains were noted under the kitchen sink at the time of inspection.  
RECOMMENDATION periodic inspection of this area is recommended. (FURTHER INSPECTION ITEM)

3F. FINDING Loose toilet was noted in the hall bathroom.  
RECOMMENDATION Building maintenance should include tightening the toilet. (SECTION II ITEM)

3G. FINDING Cracks were noted to interior sheetrock.  
RECOMMENDATION Parties of interest should consult with a sheetrock specialist regarding repair to these areas.

3H. FINDING Stains were noted on the interior master bedroom ceiling from possible plumbing leak.  
RECOMMENDATION Parties of interest should consult with a specialist regarding this condition. (FURTHER INSPECTION ITEM)

### **SUBSTRUCTURE AREA:**

4A. FINDING The subarea was fully insulated at the time of inspection. Insulation in this area restricts and prohibits visual access to subarea framing. Removal and replacement of insulation is not within the scope of this inspection.  
RECOMMENDATION Perform further inspection, if requested in writing, of the areas after all insulation has been removed for full access. (FURTHER INSPECTION ITEM)

4B. FINDING An active plumbing leaks was noted in the subarea to a ABS pipe joint or fitting.  
RECOMMENDATION Parties of interest should contact a plumbing contractor for repair of this condition. (SECTION II ITEM)

4C. FINDING No access to subarea section between garage and main structure.  
RECOMMENDATION Perform further inspection of these areas after they have been opened for complete access and inspection. (FURTHER INSPECTION ITEM)

4D. FINDING Some evidence of moisture condensation was noted on subarea foundation , and is conducive to infestation.  
RECOMMENDATION Parties of interest should consult with a Mechanical fan ventilation system specialist with regard to this issue, and any corrective measures.  
(SECTION II ITEM)

A wood destroying organisms inspection report does not include inspection for rodents, and or other wildlife pests, which is a general pest control issue  
RECOMMENDATION Parties of interest should consult with a general pest company regarding this issue and any corrective measures.

## WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No.	Street	City	Zip	Date of Inspection	Report #	Page
121	Mary Paige Lane	Santa Rosa	95404	03/27/18	121marypai	10 of 10

### **ATTIC SPACES:**

5A. FINDING Stains were noted in the attic areas from possible roof leaks.

RECOMMENDATION Parties of interest should consult with a roofing specialist regarding the integrity of the roof. (FURTHER INSPECTION ITEM)

5B. FINDING The attic area above the living area was semi accessible for inspection because of loose type insulation, and was inspected from the access opening only.

RECOMMENDATION Perform further inspection, if requested in writing of the area after all insulation has been removed, adequate cat walk type support has been installed, and a damage waiver signed.  
(FURTHER INSPECTION ITEM)

5C. A wood destroying Organisms inspection does not include inspection for rodents, which is a General Pest control issue.

RECOMMENDATION Parties of interest should consult with a general pest control professional who specializes in this type of infestation and control.